

# Manhole Inspection Summary

Manhole # S17K\_\_043MH

Printed On: 12/16/2008

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **2) Good**

Record Plat: **17K** Node: **043** Status: **Found**

Insp Date: **4/8/08 9:17 AM**

Incomplete Comments

Crew: **REI**  
Inspector: **paulfry**  
Firm: **ATS**

**Location** Address: **2514 emerson-pratt alley**

Cross Street: **catherine-franklintown alley**

**Manhole** Type: **Junction**

Location: **Alley**

Ground Conditions: **Wet**

☐ Prev. Rehab

Weather: **Light Rain**

Subject To Ponding: **Sheeting**

Comments

**Cover**

Shape: **Circular**

Diameter: **24** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick**

☐ Parged Height: **3** (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Bench**

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel**

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **1.5** nearest .5 ft. Azimuth: **165**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps**

Count: **7** Missing: **0** ☒ **Corroded**

**Surcharge**

☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S17K\_\_043MH

Printed On: 12/16/2008

Page 2 of 4

Location View



Top View



misc



bench & channel debris

Defect 3



infiltration @ barrel wall

Defect 2



corroded steps

Defect 1



cracked chimney bricks, infiltration @ corbel wall

## Manhole Inspection Summary

Manhole # S17K\_\_043MH

Printed On: 12/16/2008

Page 3 of 4

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **11.02** (ft.) Flow Characteristics: **Fast**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: **0** (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

6 in. Circular Gravity Sewer  
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: **6** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **10.46** (ft.) Flow Characteristics: **Slow**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: **0** (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

# Manhole Inspection Summary

Manhole # S17K\_\_043MH

Printed On: 12/16/2008


Page 4 of 4

8 in. Circular Gravity Sewer

5 O'Clock Inflow

Pipe In @ 5 O'Clock

Drop In @ 5 O'Clock

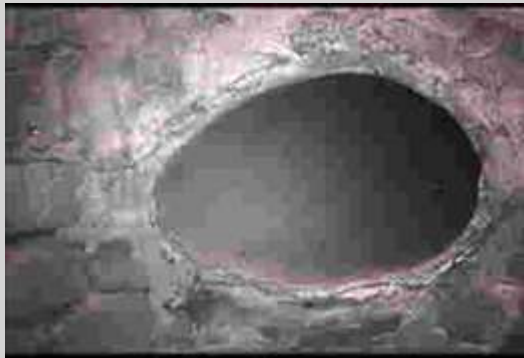

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **5.88** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ ~~Sludge~~ ☐ **Debris** ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Sound**

Drop: **Outside** Rod and Bar  
Angled: **Yes** Reading: **9.69** (ft.)  
Inv Depth: **10.69** (ft.)  
Drop Condition: **Open**

Connects To: **Connecting Node Not Available**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: **7.2** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **11.00** (ft.) Flow Characteristics: **Fast**

Deposits: ☐ None ☐ Mud ☒ ~~Sludge~~ ☒ **Debris** ☐ Grease

Silt Depth: **3** (in.) Deposits Extent: **Medium**

Infiltration: **None**

Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection